| FREA ND. 2.3.3.1 CRETICALITY 2/2 | | SHUTTLE CCTV CRITICAL ITEMS LIST | UNIT TVC/HLA DWG NO. 2294819-506.508/ 2307088-503 SHEET 1 0F 9 |
|---|---|--|--|
| FAILURE MODE AND CAUSE | FAILURE EFFECT ON END 17EH | RATIONALE: FOR ACCEPTANCE | |
| ime base errors (jitter) in the synchromization information on the video output line. Video information is present and contains the line base errors. VC 11 Sync Generator. Clock Divider Chain. Phase-locked toop. 2294880-504 12 Camera Timing Logic 2294881-501 13 Master Oscillator | (1) Loss of camera output depicting scene infor- mation within FOV of lens assembly. (2) Loss of camera until self-heating of cir- cultry restores normal operation. Morst Case: Loss of mission critical video. | The IVC/Lens Assembly is comprised of 16 electrical sub- are RCA Astro designed and fabricated using standard pr construction. The remaining three assemblies, high vol- and stepper motors, are vendor supplied components which | Inted-circuit board type of tage power supply, oscillator, in have been specified and gs (SCDs) propared by engities SCD are prepared to and acceptance requirements the Shuttle CCTV program are t defines the program requirements and consistent litary specifications at the |

Worst-Case Circuit Analyses have been performed and documented for all circuit designs to demonstrate that sufficient operating margins exist for all operating conditions. The analysis was worst case-in that the value for each of the variable parameters was set to limits that will drive the output to a maximum (or minimum).

the specific application(s) defined in the NSIAF by NASA—JSC.

general purpose preferred parts has been defined by this document and the RCA Government Systems Division Standard Parts List. In the case of the CHOS and ITL family of microcircuits, devices are screened and tested to the MIL-STD-883C equivalent and procured under the designations of MI-REL/3MQ and SMC 54LS from RCA-5SD and Texas Instruments Corp, respectively. Parts not included in the above documents have been used in the design only after a nonstandard Item approval form (MSIAF) has been prepared, submitted to Reliability Assurance Engineering (RAE) and approved for use in

A component application review and analysis was conducted to verify that the applied stress on each piece part by the temperature extremes identified with environmental qualification testing does not exceed the stress denating values identified in RCA 2295503.

In addition, an objective examination of the design was performed through a POR and COR to verify that the TVE/Lens assembly met specification and contractual requirements.

leaters

| | · | | LUNIT TYC/WLA |
|---|--|--|---|
| FHEA ND | _ _ | SHUTTLE ECTV CRITICAL ITEMS LIST | ONT 2294879-506,508/ 2307088-503 SHEET 2 OF 9 |
| FAITURE MODE AND CAUSE Imme hase errors (jitter) in the synchronization information on the sideo output line. Video information is present and contains the time base errors. IVC AL Sync Generator. Clock Divider Chain. Phase-Locked Loop. 2294880-504 AZ Camera Timing Logic 2294881-501 At 3 Master Oscillator IVC Heaters | FAILURE EFFECT ON END ITEM (1) Loss of camera autput depicting scene information within FOV of lens assembly. (2) Loss of camera until self-heating of circuitry restores normal operation. Murst Case: Loss of mission critical video. | RATIONALE FOR ACCEPTANDESIGN FEATURES (Continued) BARE BOARD DESIGN (A1) The design of the associated A1 board is constructed copper-clad epoxy glass sheets (NEMA G-10) brade fR-4 connections are made through printed traces which run board surfaces. Every trace terminates at an annular surraunds the hole in which a component lead or terminate at footing for the solder, ensuring good mech performance. Its size and shape are governed by HIL-spacing and routing. These requirements are reiteral notes to further assure compliance. Variations between the final product (due to irregularities of the etching a drawing notes. This prevents making defective boards house no lead or terminal, but serve only to electric board layers, contain stitch hars for mechanical supposed layers, contain stitch | from laminated |
| | | | |

TENU TYCZYLA 2294819-506.508/ DMG HO. SHUTTLE ECTV FMEA NO. <u>2.3.3.1</u> 2307088-503 CRITICAL ITEMS LIST SHEET CRITICALITY 2/2 FAILURE EFFECT FAILURE MODE AND RATIONALE FOR ACCEPTANCE ON END ITEM CAUSE DESIGN FEATURES (Continued) [1) Loss of camera output me base errors (illter) in the depicting scene inforinchronization information on the BARE BOARD CONSTRUCTION (A2) mation within fOV of dea output line. Video informalens assembly. on is present and contains the The A2 board is of "welded wire" construction. At the bare board level this does not (2) Loss of camera until ime base errors. distinguish it from a normal PC board except that holes which will take weld pins self-heating of cirpenerally are not connected to PC traces. Unly those pins which bring power and cuitry restores normal ground potentials to the ICs are on PCs. An annular ring surrounds the hole in the operation. Sync Generator. board where each power and ground pin is located. These pins are then soldered to Clock Divider Chain. the trace like any other component lead. Aside from this feature, all design Worst Case: Phase-Locked Loop. & construction techniques used in PC board layout apply. Loss of mission critical 2294B80-504 videa. Camera liming Logic BOARD ASSEMBLY (A2) 2294881-501 13 Haster Oscillator The drilled and etched boards are populated with several hundred solderable or weldable pins. Power and ground pins, as well as connector pins, are soldered in place. Discreet components (resistors, diodes, capacitors) are attached to bifurcated terminals, where they are soldered. Flatmack ICs are welded. eaters lead-by-lead to the tops of the weld mins. After welding, extra lead material is trimmed away. Circuit connections are made using #30 ARE nickel weld wire. The wire is welded to the pin surfaces on the board backside. All wire welds are done using a machine which is tape driven, thus eliminating the possibility of miswiring due to operator error. All wiring & circuit performance is tested prior to box-level installation. After successful testing, components are staked as required by drawing notes and the assembly is coated with prethane. The board is inserted in the box on card-edge guides, in the same manner as the other PC boards. The Al3 assembly is a temperature compensated voltage controlled crystal oscillator (TCVCXO) that is purchased to a specification controlled drawing that establishes the requirements for performance, design, test, and qualification of the unit. The product assurance provisions of the document contain the identical requirements for electronic parts and materials as the Shuttle CCTV program and must receive the approval of RCA and NASA-JSC. Mechanical and electrical integrity of the assembly is confirmed by both analysis (design reviews) and test (qualification and acceptance).

| | | REATZED 10-14-50 | | | |
|--|--|---|--|--|--|
| FHEA NO2,3.3.1 | FARAUR FEETER | SHUTTLE CCTV CRITICAL LIENS LIST | UNTT <u>TYC/HLA</u> DWG ND. <u>2294B19-506.508/</u> 2307 <u>068-503</u> SHEET <u>4</u> OF <u>9</u> | | |
| FAILURE MODE AND CAUSE The base errors (jitter) in the inchromalization information on the inchromalization information on the inchromation is present and contains the ime base errors. (C) L Symc Generator. Clock Divider Chain. Phase-Lecked Loop. 2294880-504 2 Camera Timing Logic 2294881-501 13 Master Oscillator (C) Eaters | FAILURE EFFECT ON EMD 11EM (1) Loss of camera output depicting scene infor- mation within FOV of lens assembly. (2) Loss of camera wntil self-heating of cir- cuitry restores normal operation. Morst Case: Loss of mission critical video. | QUALIFICATION TEST For Qualification Test Flow, see Table 2 locate | | | |
| ~ . | | | | | |

| | | | | METIGE 70 11 |
|--|---|---|--|--|
| FMEA NO 2.3.3.1 | | CR | SHUTTLE COTY (TICAL ITEMS LIST | UNIT TVC/VLA DMG NO. 2294819-506.588/ 2307088-503 SMEET 5 OF 9 |
| FAILURE MODE AND | FAILURE EFFECT | - | RATIONALE FOR ACCEPTANCE | |
| ime base arrors (jitter) in the synchronization information on the video output line. Video information is present and contains the lime base errors. [VC Sync Generator. Clock Divider Chaim. Phase-tocked toop. Werst Cas | ON EMD ITEM (1) Loss of camera output depicting scene information within FOV of lens assembly. (2) Loss of camera until self-heating of circuitry restores normal operation. Norst Case: Loss of mission critical video. | • Vibration: • Vibration: • Thermal Vacuum: • The VLA may not have for Acceptance fest of a line | All is subjected directly, without virmal installation, to the following 20-80 tz: 80-350 ftz: 3 d0/Oct-rise from 80-350 ftz: 350-750 ftz: 350-750 ftz: 3 d8/10 Oct-slope lest Duration: 1 Hinute per Axis Test Level: 6.1 Grms In a pressure of 1810-5 Terr, the follows: 125° f: Time to stablize equipmen 25° f: Time to stablize equipmen 125° f: Time to stablize equipmen to be een subjected to the vacuum conduct flow. See Table 1 located at the follows. All the components are operational command related components from the brough the sync lines to the Camera/must also verify the camera's abilities, and the monitor's ability to discoverify the MDH command path. Orbiter lest/Is-flight lest V System. 45 panel, select a monitor as desting | ibration isolators which might testing: 0.01 G ² /Hz temperature shall be as t plus I hour t plus I hour t plus I hour ition. ront of this book. 1. a test must verify the PHS (A7A1) panel switch, PTU, to the Camera/PTU command. ty to produce video, the VSU's isplay video. A similar test ation and the camera under t if video on monitor is indicates that the camera that the camera is producing ommands and visually (either operation. er test as source. s via the MDM command path. |

a some - 1798 - To Lo

| FHEA MD | | SHUTTLE CCTV CRITICAL ITEMS LIST | ONT 194.784.A ONG NO. 2294819-506.508/ 2307088-503 SHEET 6 OF 9 | |
|---|--|--|--|--|
| FAILURE HODE AND | FAILURE EFFECT ON END TIEM | RATIONALE FOR ACCEPTANCE | | |
| ime base errors (jitter) in the yochronization information on the ideo output line. Video information is present and contains the ime base errors. YC 1 Sync Generator. Clock Divider Chain. Phase-Locked Loop. 2294880-504 2 Camera Timing Logic 2294881-501 13 Haster Oscillator YC eaters | (!) Loss of camera output depicting scene infor- mation within FOV of lens assembly. (2) Loss of camera unti) self-heating of cir- cuitry restores normal operation. Whenst Case: Loss of mission critical video. | <u>Procurement Control</u> - The TVC/MLA EEE Parts and hardware items are procured from approved vendors and suppliers, which meet the requirements set forth in the CCTV contract and Quality Plan Hork Statement (WS-2593176). Resident DCAS personnel review all procurement documents to establish the need for GSI on selected parts | | |
| | | checking against the as-built-parts-list (ABPL). OCAS P are designated for all printed circuit, wire wrap and we harness connectors for soldering wiring, crimping, sold workmanship prior to coating of the component side of be harnesses. | elded wire baards, plus er splices and quality | |
| | • | IVC Boards | | |
| | | Specific TVC board assembly and test instructions are property and applicable documents are called out in the Fabrication (FPR-2294819) and parts list PL2294819. These includes 2593660, Process Standard RTV-566 2280881, Process Standard RTV-566 2280881, Process Standard RTV-566, Specification 1960467, Specification Soldering 2280800, Specification 1960467, Specification - Crimping 2280800, Specification 2280878, Specification - Urethane coating 2280877, Specification Epoxy Adhesive 2010985, Specification Bonding Postification - Workmanship 8030035, Specification Bonding | ion Procedure and Record shuttle TVC assembly wotes dard - Bonding Velcro Tape Name Plate Application n - Bonding and Staking dicalion - locking compound ation - Harking 2280876. | |
| | | | | |

TYCZYLA 2294819-506.508/ SHUTTLE CCTV DWG NO. 2307008-503.... CRITICAL ITEMS LIST SHEET OF CRITICALITY 2/2.. FATLURE HODE AND FAILURE EFFECT RATIONALE FOR ACCEPTANCE ON END ITEM CAUSE OA INSPECTION (Continued) Time base errors (litter) in the Lass of camera output depicting scene inforsynchronization information on the mation within FOV of video outqut line. Video informa-IVE Assembly and lest - An open box test is performed per IP-IV-2294819, and an tion is present and contains the lans assembly. Acceptance Test per IP-AT-2294819, including vibration and thermal vacuum. Torques (2) Loss of camera until time base errors. are specified and witnessed, traceability numbers are recorded and callbrated tools self-heating of cirare checked prior to use. RCA Quality and DCAS inspections are performed at the comcuitry restares normal pletion of specified FPR operations in accordance with PAI 204, PAI 205, PAI 206 and operation. Al Sunc Generator. PAI 217. OCAS personnel witness TVC button-up and critical torquing. Clock Divider Chain. Norst Case: Phase-Locked Loop. <u>WLA Assembly and Test - Am open box test is performed per TP-II-2307088. Acceptance Test</u> Lass of mission critical 2794880-504 per TP-AT-2307088. Torques are specified and witnessed, traceability numbers are video. recorded and calibrated tools are checked prior to use. RCA Quality and DCAS inspections A2 Camera Timing Logic 2294881-501 are performed at the completion of specified FPR operations in accordance with PAI 204. Al3 Master Oscillator PAI 205. PAI 217 and PAI 402. DCAS personnel witness WLA button-up and critical torquing. IVC/MLA Assembly and lest - After a TVC and a MLA have been tested individually. TVC Heaters they are mated and a final acceptance test is performed per IP-AT-2294819, including vibration and thermal vacuum environments. RCA and DCAS personnel monitor these tests and review the acceptance test data/results. These personnel also inspect for conformance after all repair, remork and retest. <u>Preparation for Shipment</u> - The TYC and WLA are separated prior to shipment after fabrication and testing is complete. Each is packaged according to CCTV Letter 8011 and 2200746. Process standard for Packaging and Handling guidelines. All related documentation including assembly drawings, Parts List, ABPL, Test Data, etc., is gathered and held in a documentation folder assigned specifically to each assembly. This folder is retained for reference. An EIDP is prepared for each assy in accordance with the requirements of MS-2593176. RCA OC and DCAS personnel witness crating, packaging, packing and marking, and review the EIDP for completeness and accuraty.

| FNEA NO. 2.3.3.1 CRITICALITY 2/2 | _ _ | | SHUTTLE CCTV CRITICAL ITEMS LIST | DHG NO. | 230701 | 9-506.508/ 98-503 OF 9 |
|--|---|-----------------------|-------------------------------------|---------|--------|------------------------------|
| FAILURE HODE AND CAUSE | FAILURE EFFECT ON END ITEM | | RATIONALE FOR ACCEPTANCE | | | |
| ime base errors (jitter) in the ynchronization information on the ideo output line. Video information is present and contains the ime base errors. YC 1 Sync Generator. Clock Divider Chain. Phase-Locked Loop. 2294880-504 2 Camera Timing Logic 2294861-501 13 Master Oscillator | (1) toss of camera output depicting scene Infor- mation within FOV of lens assembly. (2) loss of camera until self-heating of cir- cuitry restores normal operation. Morst Case: Loss of mission critical video. | FAILURE MISTORY HONE. | | | | |
| <u>vC</u> eaters | | | | | | |
| | | | | | | |

| FNEA NO | | SHUTTLE CCTV CRITICAL ITEMS LIST | UHIT TVC/MLA DNG NO 2294819-506,508/ 2307088-503 SHEET 9 OF 9 | | | |
|---------|---|---|---|--|--|--|
| | FAITURE EFFECT ON END LIEM (1) Loss of camera output depicting scane information within FOV of lens assembly. (2) Loss of camera until self-heating of circuitry restores normal operation. Worst Case: Loss of mission critical video. | RATIONALE FOR ACCEPTANCE OPERATIONAL EFFECTS Loss of video. Possible loss of major mission objectives due to loss of RMS cameras or other required cameras. | | | | |
| | | | | | | |